

LOC I-SYA 110.1	APCH CRS 287°	Rwy Idg 10,004 TDZE 93 Arpt Elev 98
---------------------------	-------------------------	--

[USAF]

EARECKSON AS (SYA) (PASY)


* Circling not authorized N of Rwy 10-28.



MISSED APPROACH: Climb to 600, then climbing left turn to 3000 direct FOMDA and hold.

ANCHORAGE CENTER 119.1 339.8	CTAF 127.2 0 352.05
--	-------------------------------

CAUTION: Numerous obstructions in area N of Rwy 10-28.
Missed approach requires use of RNAV or ATC RADAR monitoring.

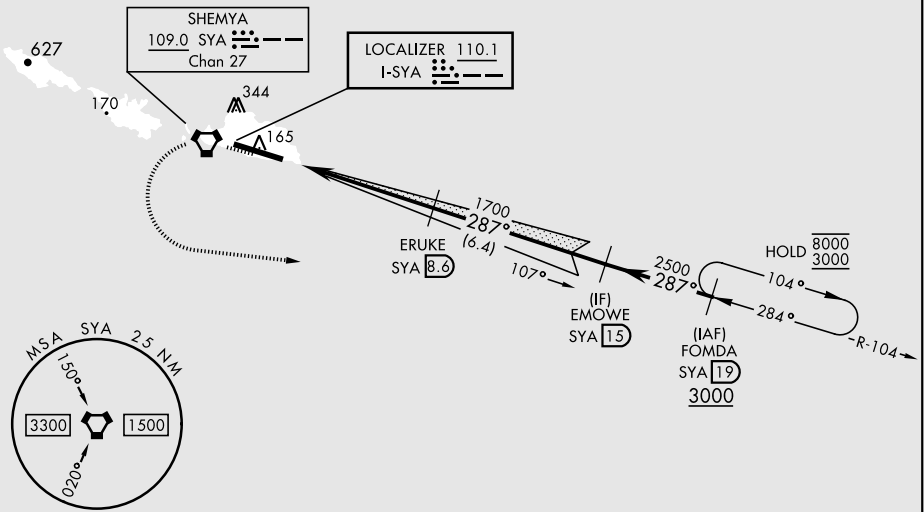

EMERG SAFE ALT 100 NM 5400

600

3000

FOMDA SYA (19)

VGSI and ILS glidepath not coincident (VGSI Angle 2.50/TCH 46).

ELEV 98

TDZE 93

CATEGORY	A	B	C	D	E
S-ILS 28	293-1		200	(200-1)	
S-LOC 28	460-1		367	(400-1)	
CIRCLING*	460-1 362 (400-1)	560-1 462 (500-1)	560-1 ½ 465 (500-1 ½)	660-2 562 (600-2)	680-2 582 (600-2)

 HIRL Rwy 10-28
 REIL Rwy 10 and 28

AK, 20 FEB 2025 to 17 APR 2025

AK, 20 FEB 2025 to 17 APR 2025