

STANDARD DEPARTURE CHART -INSTRUMENT

RJNA / NAGOYA

SID

HOUBA FOUR DEPARTURE

RWY16 : Climb RWY HDG to 600FT, turn left HDG349° ...


RWY34 : Climb RWY HDG to 700FT, turn right within 4NM from RWY end/
KCC 4.0DME, via HDG079° ...

...to intercept and proceed via KCC R034 to HOUBA.
Cross HOUBA at or above 8000FT.

Note RWY16 : 5.0% climb gradient required up to 600FT.

RWY34 : 5.0% climb gradient required up to 700FT.

CHANGE : Description of PROC name.

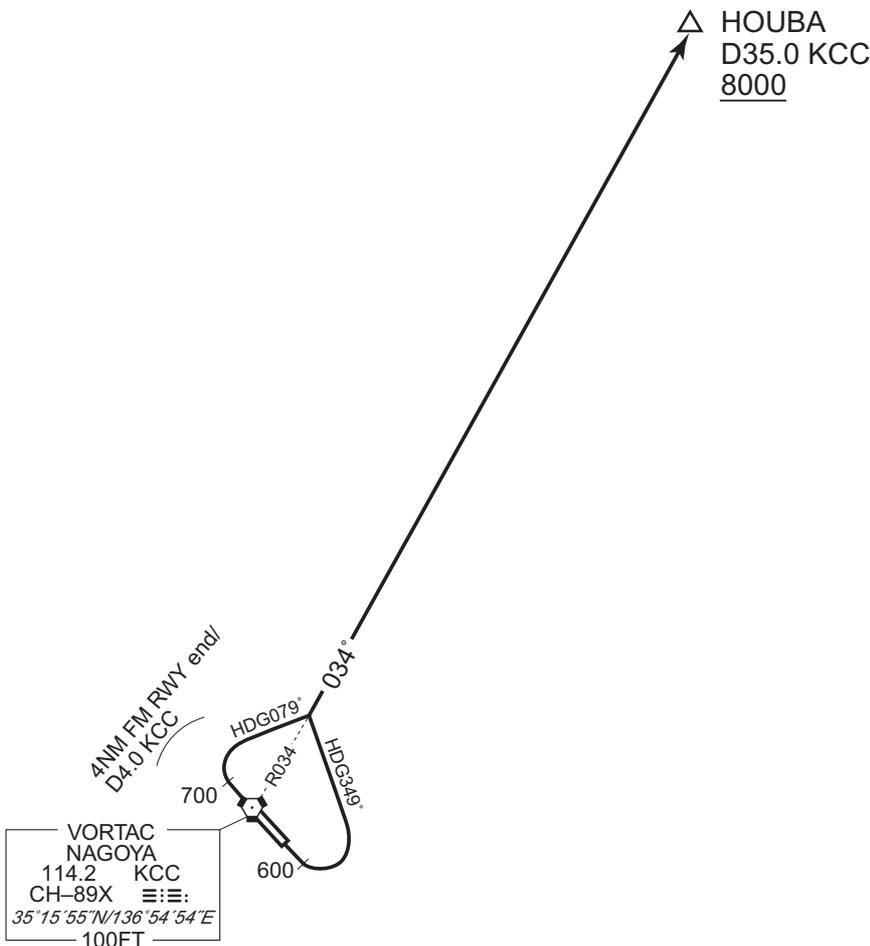

STANDARD DEPARTURE CHART -INSTRUMENT

RJNA / NAGOYA

TRANSITION

KROBE TRANSITION

From over HOUBA, via KCC R034 to KROBE via STRAW.
Cross STRAW at or above FL200.

NIIGATA TRANSITION

From over HOUBA, via KCC R034 to KROBE via STRAW,
via GTC R228(MRA FL220 for using TACAN only) to GTC VORTAC.
Cross STRAW at or above FL200.

CHANGE : MRA for using GTC TACAN added.

