


INSTRUMENT APPROACH CHART


RJFZ / TSUIKI

TACAN Y RWY25

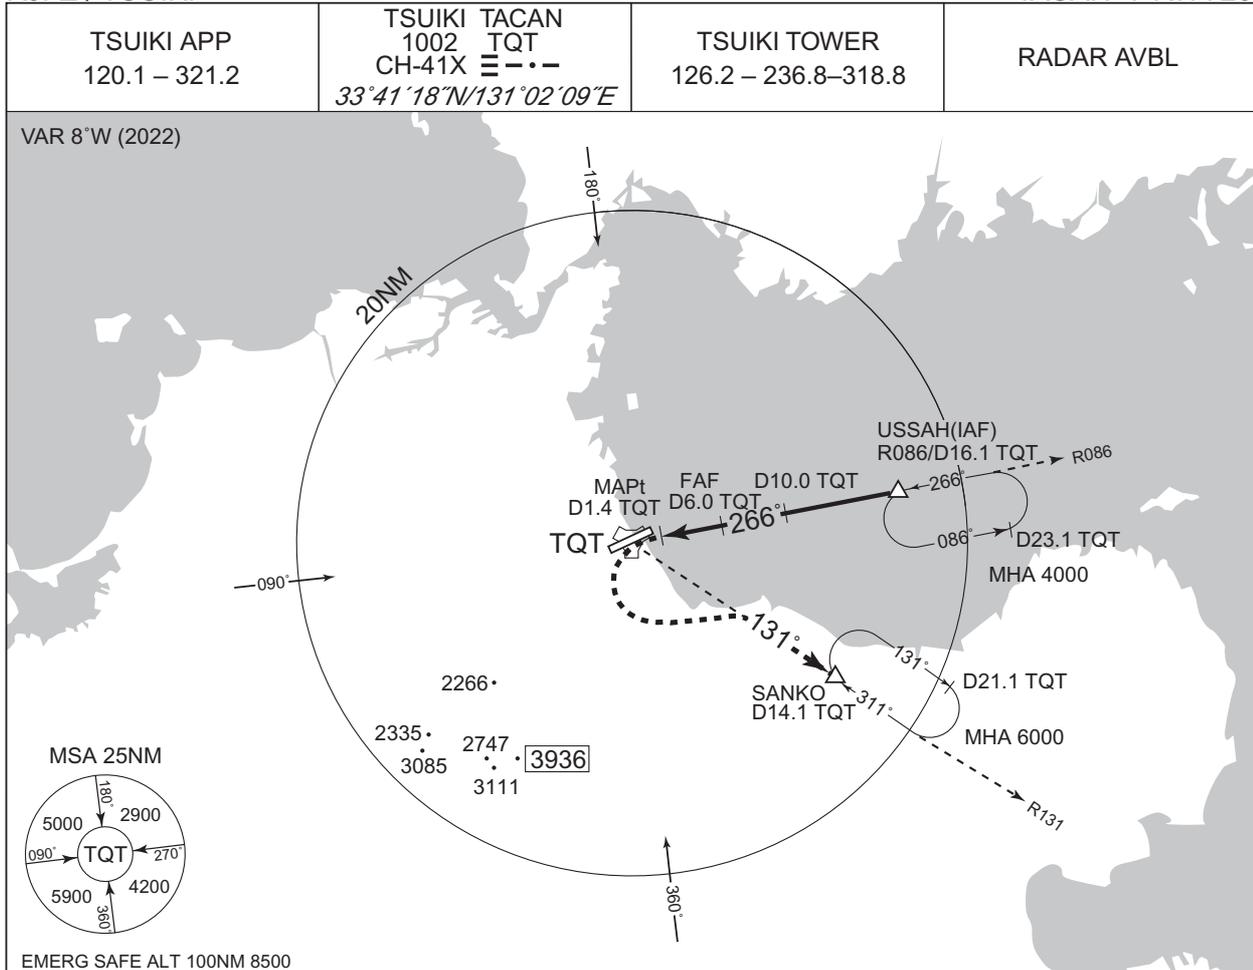

CHANGE : MHA: Description of RADAR Service.

**MISSED APPROACH**  
At 1.4DME prior to TQT TACAN, climb to 6000FT, and turn left to intercept and proceed via TQT R131 to SANKO and hold.  
Contact TSUIKI APP.

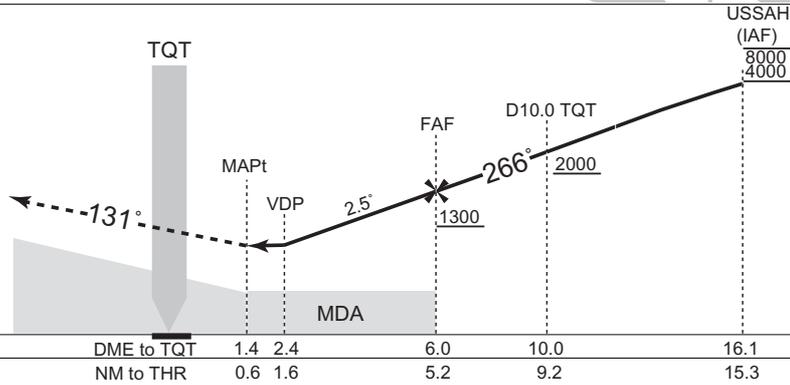

|        |           |              |             |      |
|--------|-----------|--------------|-------------|------|
| MINIMA |           | THR elev. 19 | AD elev. 28 |      |
| CAT    | MDA(H)    | RVR/<br>CMV  | CIRCLING    |      |
|        |           |              | MDA(H)      | VIS  |
| A      | 440 (421) | 1500         | 520 (492)   | 1600 |
| B      |           |              | 660 (632)   |      |
| C      |           |              | 760 (732)   | 2400 |
| D      |           |              | 810 (782)   | 3200 |