


INSTRUMENT APPROACH CHART

RJFZ / TSUIKI

TACAN Z RWY25

TSUIKI APP 120.1 – 321.2	TSUIKI TACAN 1002 TQT CH-41X 33°41'18"N/131°02'09"E	TSUIKI TOWER 126.2 – 236.8–318.8	RADAR AVBL
-----------------------------	--	-------------------------------------	------------


VAR 8°W (2022)

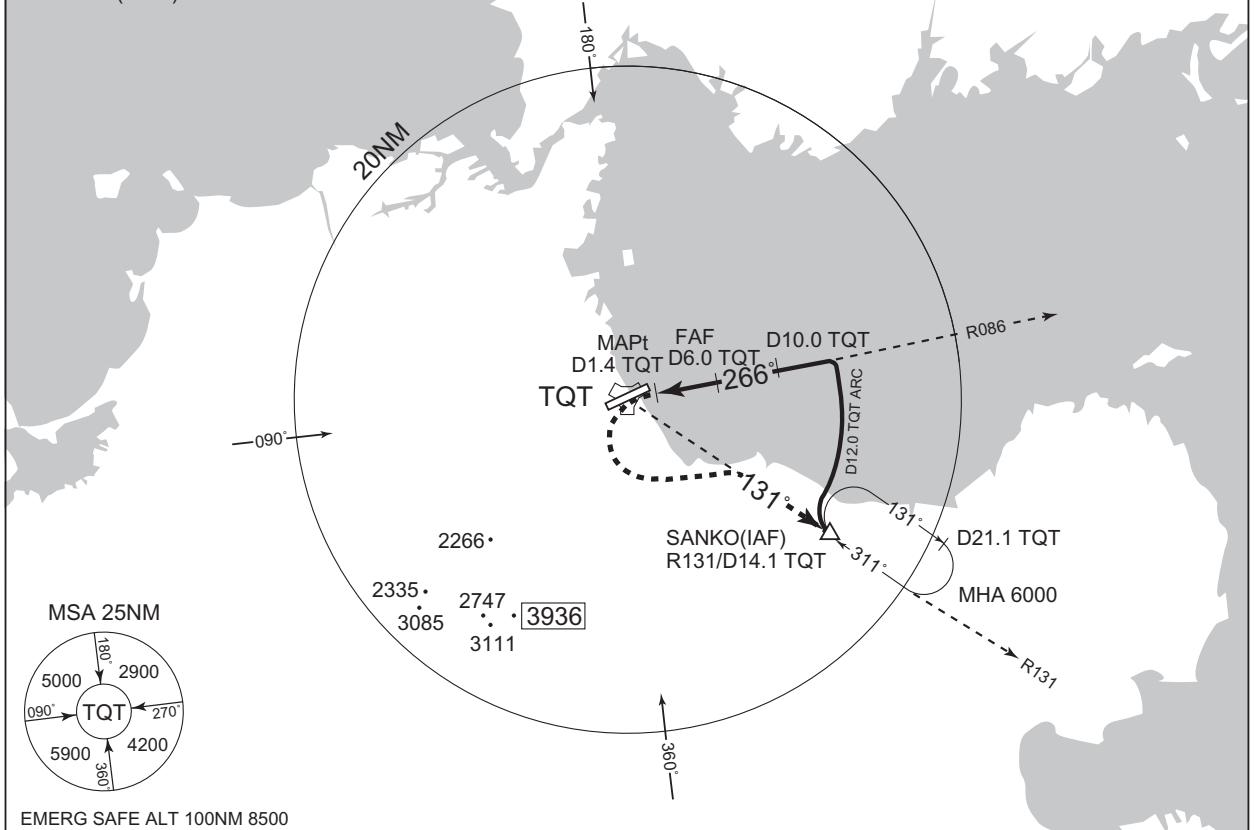

CHANGE : ALT restriction at SANKO. MHA. Description of RADAR Service.

EMERG SAFE ALT 100NM 8500

MISSED APPROACH
At 1.4DME prior to TQ TACAN,
climb to 6000FT, and turn left to
intercept and proceed via
TQT R131 to SANKO
and hold.
Contact TSUIKI APP.

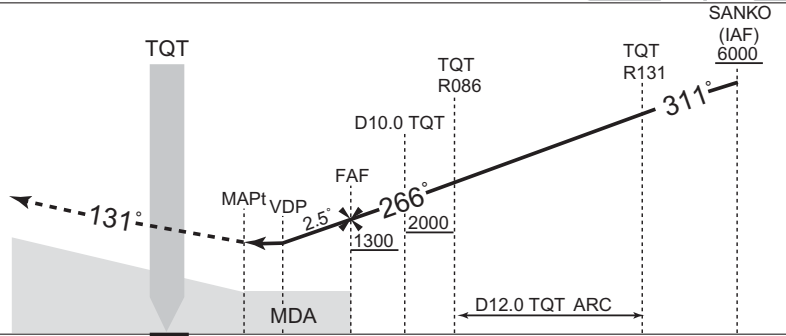

DME to TQT	1.4	2.4	6.0	10.0	12.0
NM to THR	0.6	1.6	5.2	9.2	11.2

MINIMA		THR elev. 19	AD elev. 28	
CAT			CIRCLING	
	MDA(H)	RVR/CMV	MDA(H)	VIS
A	440 (421)	1500	520 (492)	1600
B			660 (632)	
C			760 (732)	2400
D			810 (782)	3200