

STANDARD ARRIVAL CHART-INSTRUMENT

RJFF / FUKUOKA

STAR

EBISU E ARRIVAL

From over EBISU, proceed via IKE R074 to intercept and proceed via SGE R353 to IGDER, via KUE R329, to intercept and proceed via SGE R064 to ADPAR.

Cross SGE R353/36.0DME between 7000FT and 10000FT, cross KUE R329/35.0DME at or above 6000FT, cross ADPAR at or above 4000FT.

EBISU W ARRIVAL

From over EBISU, proceed via IKE R074 to intercept and proceed via SGE R353 to IGDER, via KUE R329, to intercept and proceed via SGE R064 to BUBTI.

Cross SGE R353/36.0DME between 7000FT and 10000FT, cross KUE R329/35.0DME at or above 6000FT, cross BUBTI at or above 4000FT.

IKI E ARRIVAL


From over IKE VOR/DME, proceed via IKE R074 to intercept and proceed via SGE R353 to IGDER, via KUE R329, to intercept and proceed via SGE R064 to ADPAR.

Cross SGE R353/36.0DME between 7000FT and 10000FT, cross KUE R329/35.0DME at or above 6000FT, cross ADPAR at or above 4000FT.

IKI W ARRIVAL

From over IKE VOR/DME, proceed via IKE R074 to intercept and proceed via SGE R353 to IGDER, via KUE R329, to intercept and proceed via SGE R064 to BUBTI.

Cross SGE R353/36.0DME between 7000FT and 10000FT, cross KUE R329/35.0DME at or above 6000FT, cross BUBTI at or above 4000FT.

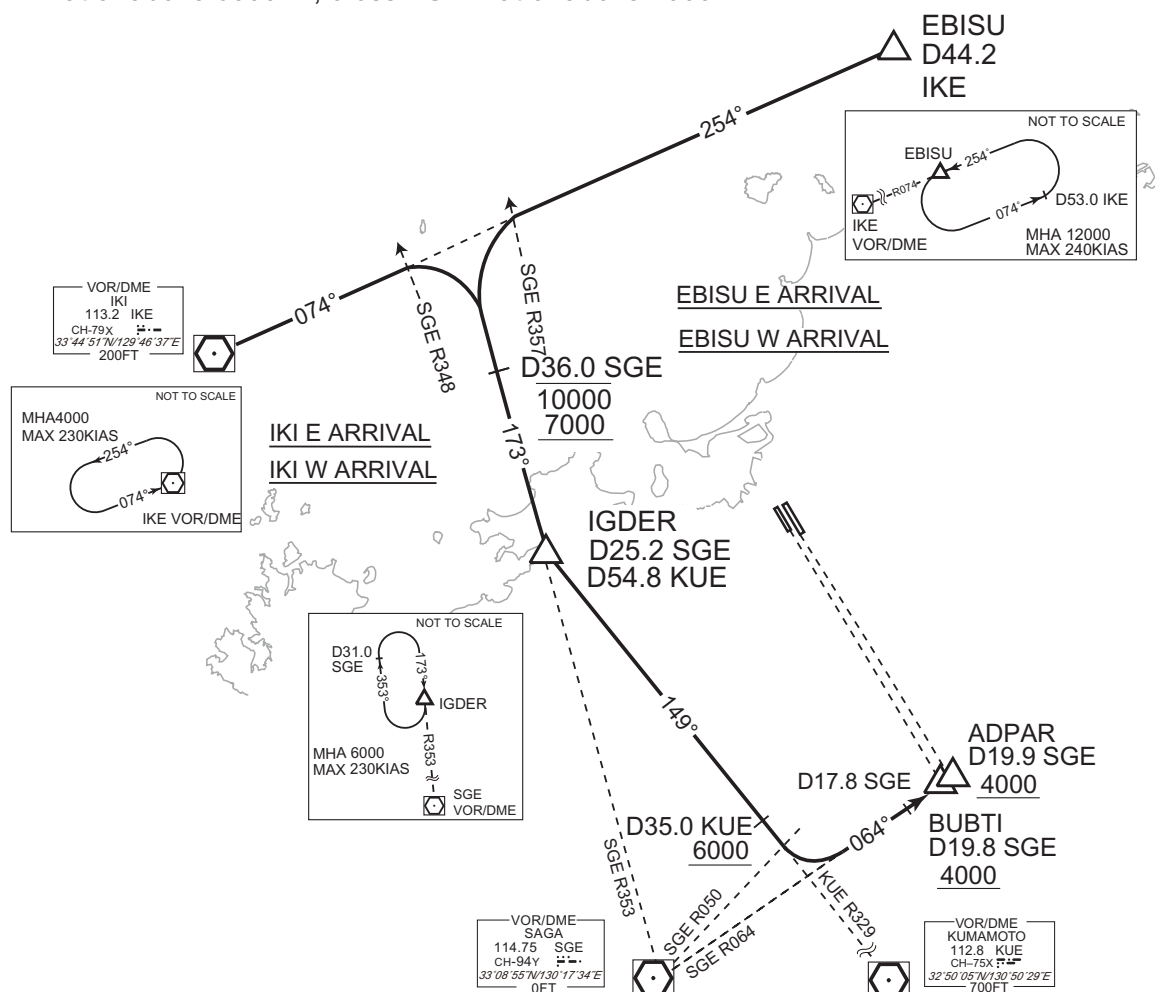

CHANGE : New PROC.