
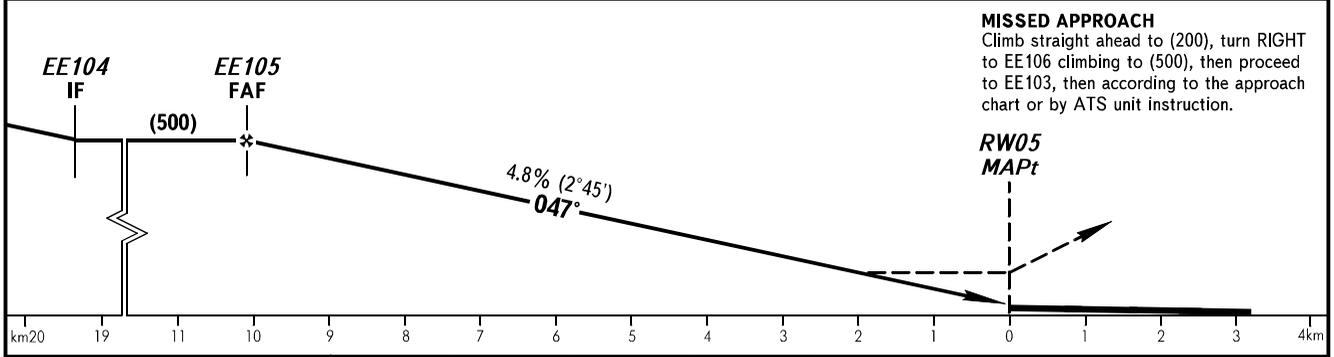


INSTRUMENT
APPROACH
CHART - ICAO

APPROACH	125.500
START	118.300

KEMEROVO, RUSSIA
KEMEROVO
RNAV RWY 05

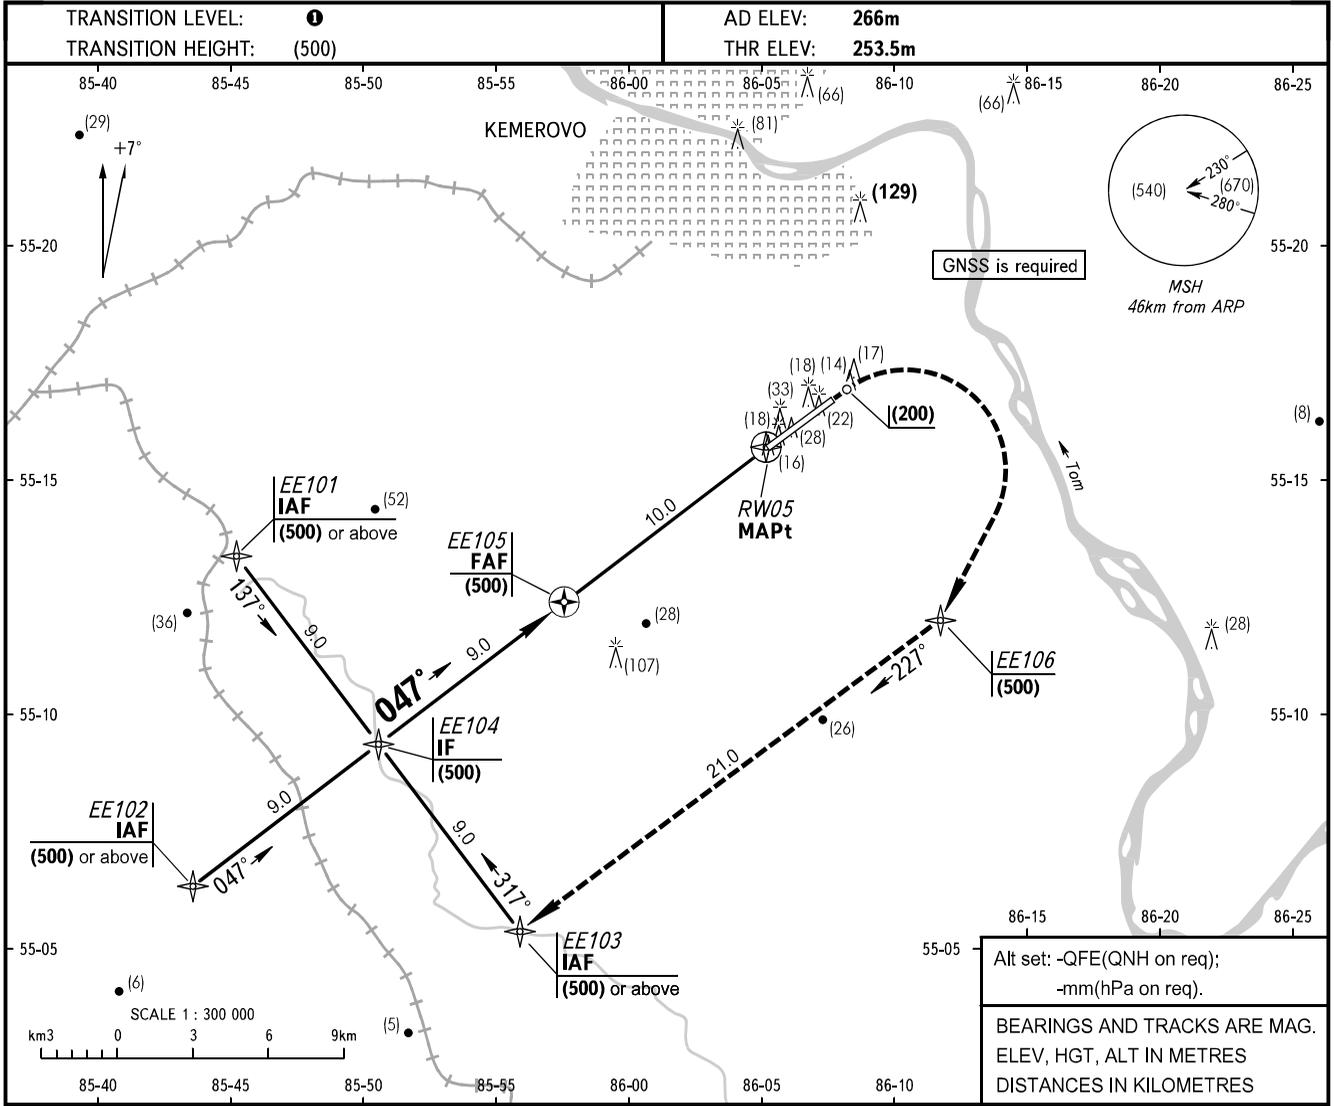

Alt set: -QFE(QNH on req);
-mm(hPa on req).

BEARINGS AND TRACKS ARE MAG.
ELEV, HGT, ALT IN METRES
DISTANCES IN KILOMETRES

MISSED APPROACH
Climb straight ahead to (200), turn RIGHT to EE106 climbing to (500), then proceed to EE103, then according to the approach chart or by ATS unit instruction.

OCA(H)		A	B	C	D
Straight-in	With FAF	370(115)	370(115)	370(115)	370(115)
	WO FAF	385(130)	385(130)	385(130)	385(130)
Approach					

WARNING
Ground Proximity Warning System is subject to functioning.

1 TRANSITION LEVEL:
- FL030 when QFE is 760mm mercury column or above;
- FL040 when QFE is 733mm mercury column or above, but less than 760mm mercury column;
- FL050 when QFE is less than 733mm mercury column.

GROUND SPEED	km/h	150	180	210	240	270	300	330	360	390	420	450
RATE OF DESCENT	m/s	2.0	2.4	2.8	3.2	3.6	4.0	4.4	4.8	5.2	5.6	6.0

CHANGE: New chart