



CARTA DE USO EXCLUSIVO MILITAR
MILITARY ONLY USE CHART

CAMBIOS: FRECUENCIA TWR.
CHANGES: TWR FREQUENCY.

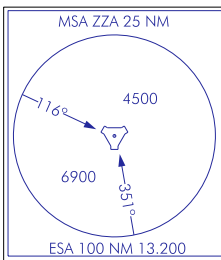

PRECAUCIÓN: TERRENO ALTO AL SE-SW DEL AEROPUERTO.
CAUTION: HIGH TERRAIN SE-SW OF THE AIRPORT.



ZARAGOZA AD

SALIDAS POR INSTRUMENTOS (DEP) - MIPS

→ PISTA 12

SALIDA BARDENAS

Subir en R-122 ZZA para cruzar 10.0 DME ZZA a 4000 ft o inferior. Virar a la izquierda para seguir rumbo magnético 036°, cruzar R-091 ZZA a 5000 ft o superior, interceptar arco 20.0 DME ZZA a FL070 o superior (R-067 ZZA). Proceder en arco 20.0 DME ZZA a VICTOR, virar a la derecha para seguir rumbo magnético 293° hasta interceptar R-343/26.0 DME ZZA directo a BARDENAS.

Nota: En BARDENAS entre 6000 ft ALT y FL080, velocidad máxima 280 kt.

FIJO BARDENAS: R-333/36.0 DME ZZA.

SALIDA TANGO

Subir en R-122 ZZA para cruzar 9.4 DME ZZA a 2500 ft o superior. Virar a la derecha para seguir rumbo magnético 177° para interceptar R-140 ZZA a 4000 ft o superior, directo a cruzar TANGO a FL080 o superior. Virar a la izquierda para seguir R-288 MLA directo a DVOR/DME MLA.

PISTA 30

SALIDA BARDENAS

Subir en R-302 ZZA para cruzar 10.0 DME ZZA a 4000 ft o inferior. Virar a la derecha para seguir rumbo magnético 002° hasta interceptar R-343/26.0 DME ZZA, a altitud o nivel asignado, virar a la izquierda directo a BARDENAS.

Nota: En BARDENAS entre 6000 ft ALT y FL080, velocidad máxima 280 kt.

FIJO BARDENAS: R-333/36.0 DME ZZA.

SALIDA TANGO

Subir en R-302 ZZA para cruzar 5.0 DME ZZA a 1700 ft o superior. Virar a la izquierda para seguir rumbo magnético 167°, cruzar R-272 ZZA a 3100 ft o superior, directo a cruzar FESTA (R-188/14.2 DME ZZA) a FL070 o superior. Seguir rumbo magnético 107° directo a cruzar TANGO a FL080 o superior. Seguir R-288 MLA directo a DVOR/DME MLA.

INSTRUMENT DEPARTURES (DEP) - MIPS

RUNWAY 12

BARDENAS DEPARTURE

Climb on R-122 ZZA to cross 10.0 DME ZZA at 4000 ft or below. Turn left to follow magnetic heading 036°, to cross R-091 ZZA at 5000 ft or above, to intercept arc 20.0 DME ZZA at FL070 or above (R-067 ZZA). Proceed on arc 20.0 DME ZZA to VICTOR, turn right to follow magnetic heading 293° to intercept R-343/26.0 DME ZZA, direct to BARDENAS.

Note: Over BARDENAS between 6000 ft ALT and FL080, maximum speed 280 kt.

FIX BARDENAS: R-333/36.0 DME ZZA.

TANGO DEPARTURE

Climb on R-122 ZZA to cross 9.4 DME ZZA at 2500 ft or above. Turn right to follow magnetic heading 177° to intercept R-140 ZZA, at 4000 ft or above, direct to cross TANGO at FL080 or above. Turn left to follow R-288 MLA direct to DVOR/DME MLA.

RUNWAY 30

BARDENAS DEPARTURE

Climb on R-302 ZZA to cross 10.0 DME ZZA at 4000 ft or below. Turn right to follow magnetic heading 002° to intercept R-343/26.0 DME ZZA, at assigned altitude or level, turn left direct to BARDENAS.

Note: Over BARDENAS between 6000 ft ALT and FL080, maximum speed 280 kt.

FIX BARDENAS: R-333/36.0 DME ZZA.

TANGO DEPARTURE

Climb on R-302 ZZA to cross 5.0 DME ZZA at 1700 ft or above. Turn left to follow magnetic heading 167°, cross R-272 ZZA at 3100 ft or above, direct to cross FESTA (R-188/14.2 DME ZZA) at FL070 or above. Follow magnetic heading 107° direct to cross TANGO at FL080 or above. Follow R-288 MLA direct to DVOR/DME MLA.