


FARO DEP INFORMATION 121.560	FARO, Gago Coutinho (LPFR)
FARO TOWER 120.755	RWY 10
FARO APPROACH 119.405	AMSEL 7E, BAROK 7E, NARTA 7E
LISBOA CONTROL 125.550	ODEM 7E, OPTOR 7E, XABAS 9E, XABAS 7E

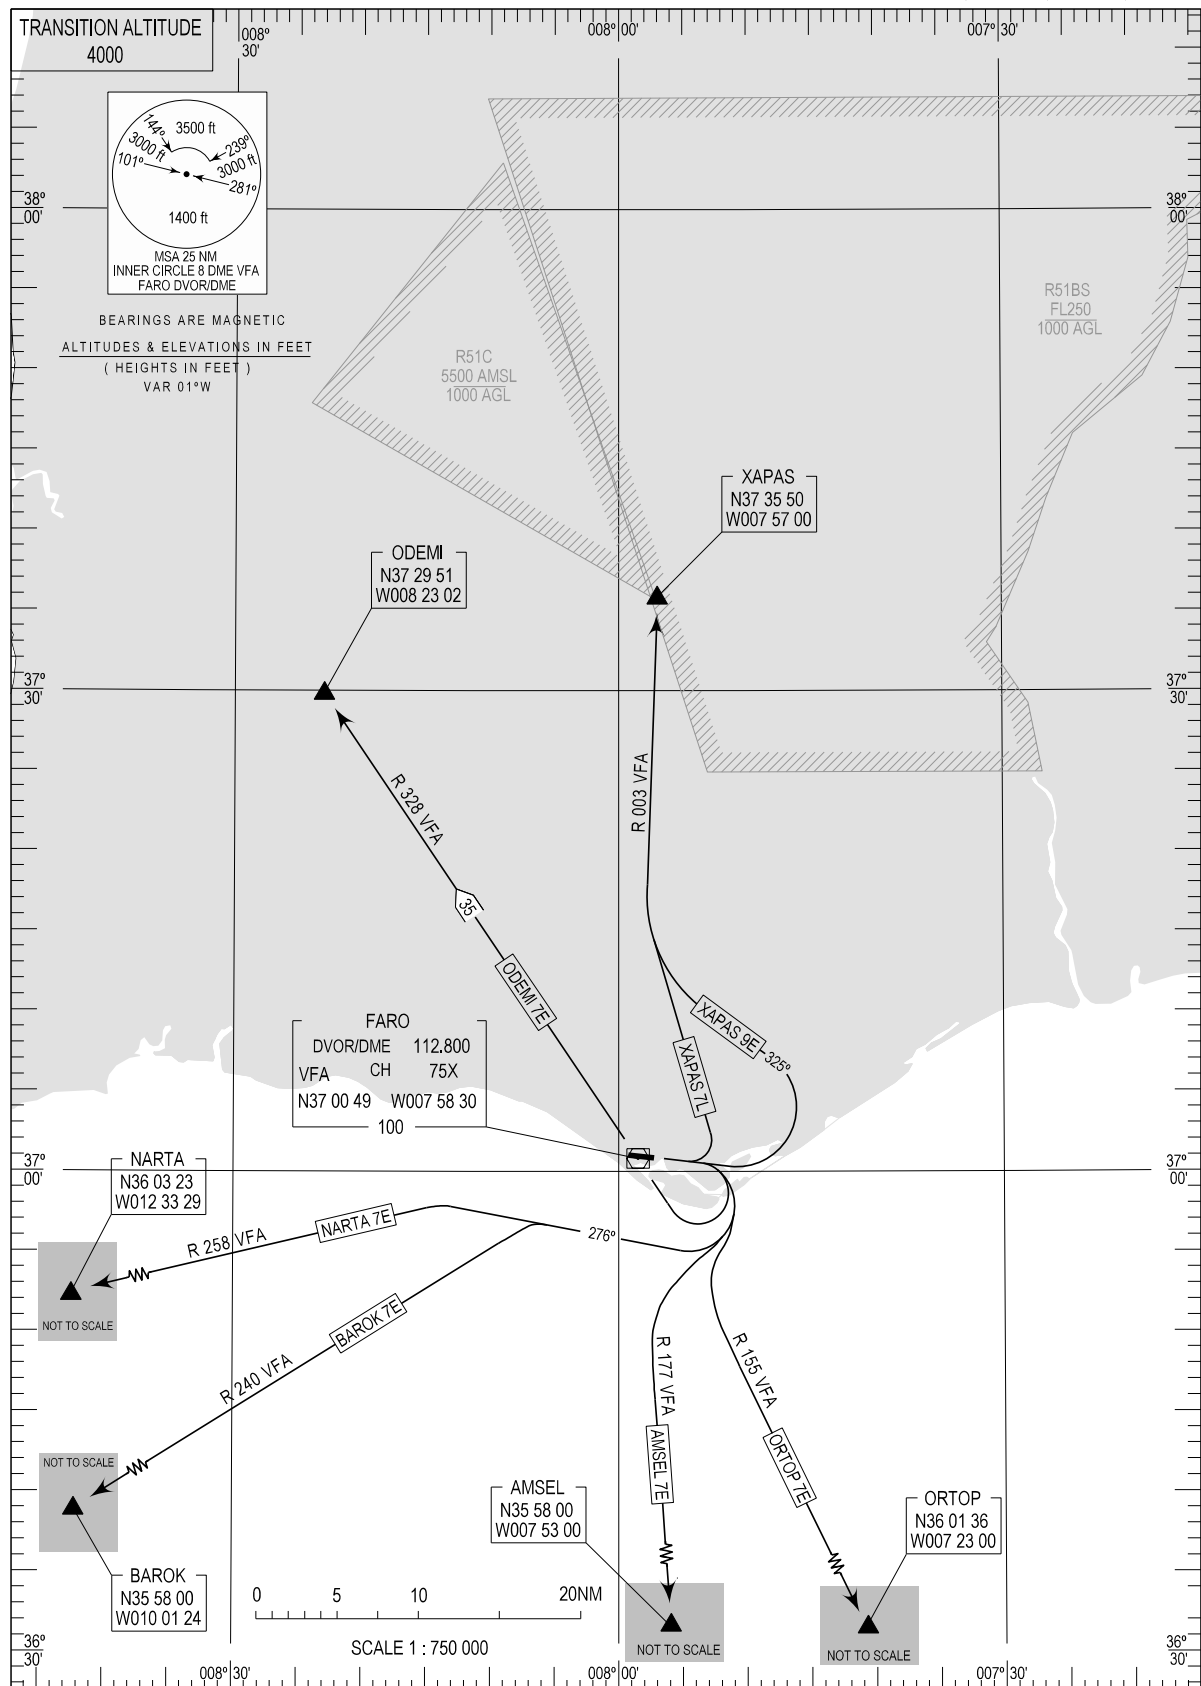

AD name inserted.

STANDARD INSTRUMENT DEPARTURE (SID) RWY 10

Designator	Route	After Take-off		Remarks
		Climb to ALT/FL	Contact	
AMSEL7E	Turn right to intercept and proceed on RDL 177 VFA DVOR/DME to AMSEL	FL060	FARO APPROACH 119.405 MHZ	
BAROK7E	Turn right to track 276° to intercept and proceed on RDL 240 VFA DVOR/DME to BAROK			
NARTA7E	Turn right to track 276° to intercept and proceed on RDL 258 VFA DVOR/DME to NARTA			
ODEMI7E	Turn right to VFA DVOR/DME; proceed on RDL 328 VFA DVOR/DME to ODEMI			Cross VFA DVOR/DME at 2500FT QNH or above.
ORTOP7E	Turn right to intercept and proceed on RDL 155 VFA DVOR/DME to ORTOP			
XAPAS9E	Climb on Runway heading. When passing 3000FT QNH but not before 4NM VFA DVOR/DME, turn left track 325 to intercept and proceed on RDL003 VFA DVOR/DME to XAPAS.			Only to be assigned by ATC.
XAPAS7L	Turn left to intercept and proceed on RDL003 VFA DVOR/DME to XAPAS			Only to be assigned by ATC. For light Aircraft only.