

STANDARD DEPARTURE CHART-INSTRUMENT

RJSA / AOMORI

SID and TRANSITION

IWAKI SEVEN DEPARTURE

- RWY06 : Climb RWY HDG to 1100FT, turn left HDG 292° to intercept and proceed via MRE R331 to 12.0DME, turn left, via HWE R208 to GONOU.
Cross MRE R331/8.0DME at or above 3600FT, cross HWE R208/63.0DME at or above 7000FT, cross GONOU at or above 9000FT.
- RWY24 : Climb RWY HDG to 1200FT, via MRE R239 to GONOU.
Cross GONOU at or above 9000FT.

Note RWY24 : No turn before DER.

5.0% climb gradient required up to 1200FT.

OBST ALT 782FT located at 0.8NM 223° FM end of RWY24.


YUWA TRANSITION

From over GONOU, via UWE R010 to UWE VOR/DME.

NYUDO TRANSITION

From over GONOU, via MRE R239 to NYUDO.

Cross NYUDO at or above FL210.

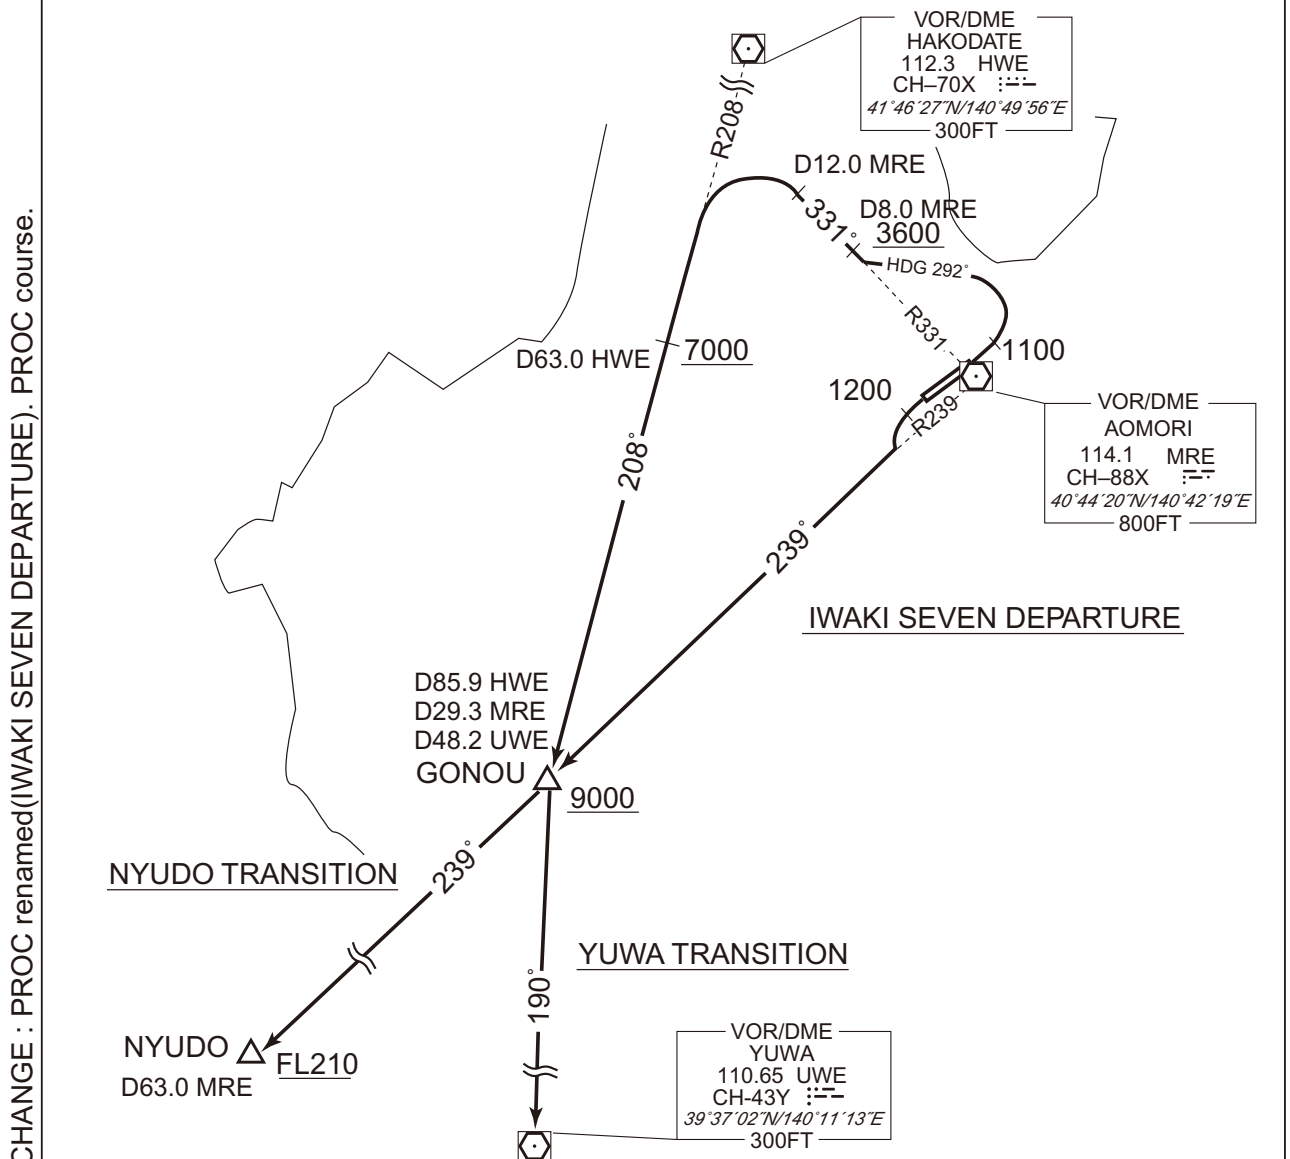

STANDARD DEPARTURE CHART-INSTRUMENT

RJSA / AOMORI

SID

AOMORI REVERSAL THREE DEPARTURE


RWY06 : Climb RWY HDG to 1100FT, turn left HDG 286°...

RWY24 : Climb RWY HDG to 1200FT, turn right HDG 016°...

...to intercept and proceed via MRE R331 to 10.0DME, turn left,
direct to MRE VOR/DME.Cross MRE R331/8.0DME at or above 3600FT, cross MRE VOR/DME
at or above 6500FT.

Note RWY24 : 5.0% climb gradient required up to 1200FT.

OBST ALT 782FT located at 0.8NM 223° FM end of RWY24.

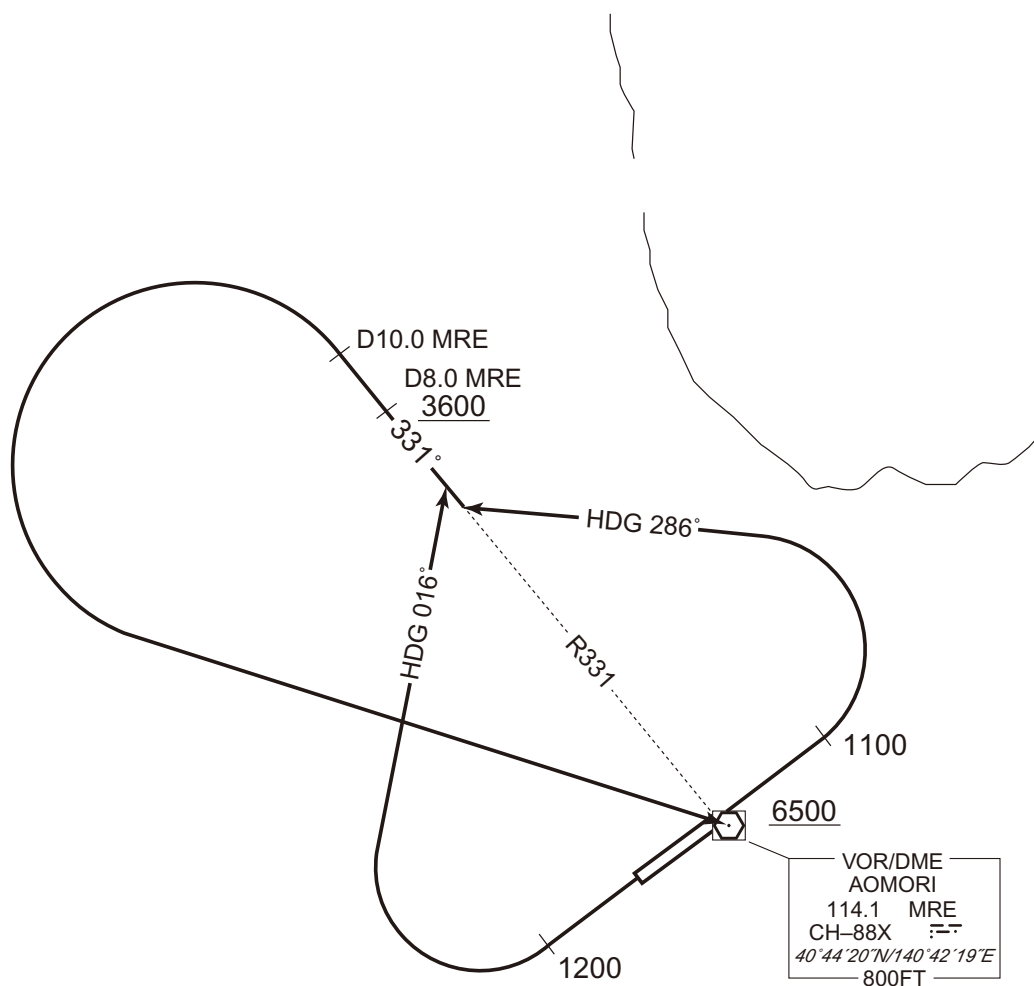

CHANGE : PROC renamed. PROC course.