

GOLDSBORO, NORTH CAROLINA

TACAN GSB Chan 112	APCH CRS 081°	Rwy Idg 11,760 TDZE 73 Arprt Elev 109
------------------------------	-------------------------	--


[USAF]

HI-TACAN Z RWY 8

SEYMOUR JOHNSON AFB (KGSB)

▼ * When ALS inop, increase vis to 1½ miles. ** Circling N of Rwy 8-26 not authorized.	ALSF-1 A1	MISSED APPROACH: Climb to 2300 via GSB TACAN R-081 to ZILOB and hold.
--	--	---

ATIS ★ 317.625	APP CON 123.7 290.9 (258°- 110°) 119.7 273.6 (111°- 257°)	TOWER ★ 126.25 370.875	GND CON 132.45 275.8	CLNC DEL 128.025 270.8
--------------------------	---	----------------------------------	--------------------------------	----------------------------------

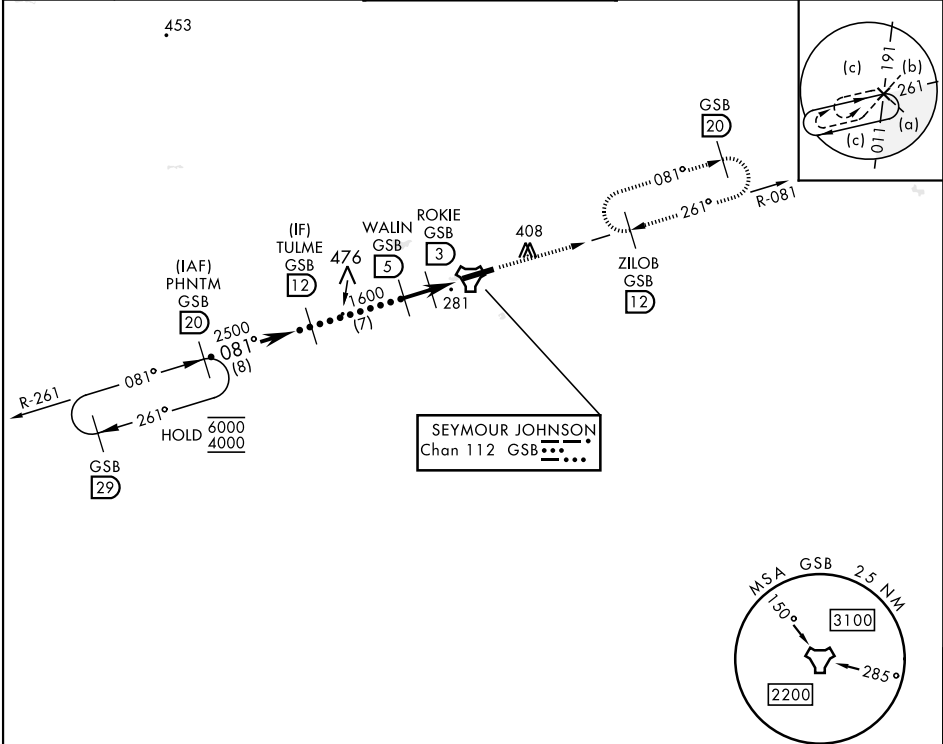

EMERG SAFE ALT 100 NM 3700

↑ WALIN to ZESIX			2300 GSB R-081	ZILOB GSB 12	ELEV 109	TDZE 73
PHNTM R-261 20 TULME 12 WALIN 5 ROKIE 3 ZESIX 1.7 0.9 TACAN			4000 2500 1600 960 2 NM2.1 NM0.5 NM			
CATEGORY	C		D		E	
S-8 *	540/50		467 (500-1)			
CIRCLING **	680-1½ 571 (600-1½)		740-2 631 (700-2)		740-2¼ 631 (700-2¼)	
			HIRL Rwy 8-26			

Amdt 8 03NOV22

HI-TACAN Z RWY 8