

Akureyri MILITARY TACAN RWY 01

21308

AKUREYRI, ICELAND

TACAN RWY 01

TACAN	MOB	APCH CRS	Rwy ldg	7874
Chan	95	025°	THRE	7
			Arpt Elev	7

AL-1681 [USAF]

AKUREYRI (BIAR)


When VGSI inop, procedure not authorized at night.



† MISSED APPROACH: Climbing to 6300, upon leaving 2300 turn left to intercept MOB TACAN R-007 outbound to EBOLU (MOB R-007/22 DME) and hold.

REYKJAVIC ACC 119.7	APP CON 118.2	TOWER ★ 118.2
------------------------	------------------	------------------

USAF Only: When VGSI inop, straight-in Rwy 01 authorized at night with MAJCOM A3 approval.

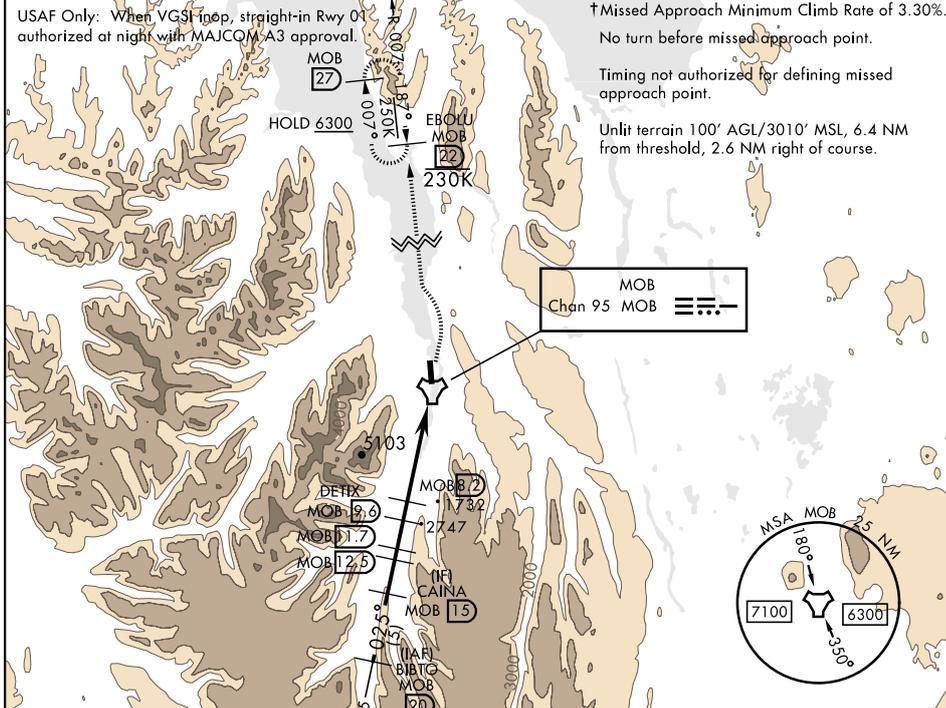

† Missed Approach Minimum Climb Rate of 3.30%.


No turn before missed approach point.

Timing not authorized for defining missed approach point.


Unlit terrain 100' AGL/3010' MSL, 6.4 NM from threshold, 2.6 NM right of course.

EMERG SAFE ALT 100 NM 8700

FOR USE BY MILITARY
AIR POLICING AIRCRAFT ONLY

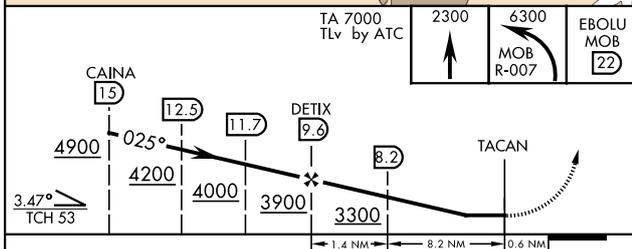

CATEGORY	A	B	C	D	E
S-01		2130-5000m	2123	(2200-5000m)	
CIRCLING	NOT AUTHORIZED				

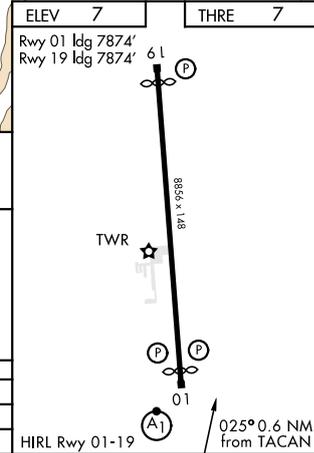

AKUREYRI, ICELAND

65°39'N-18°04'W

AKUREYRI (BIAR)

Amdt 1 04NOV21
MIPS

TACAN RWY 01

THIS PAGE INTENTIONALLY LEFT BLANK