

APPROCHE AUX INSTRUMENTS

Instrument approach

CAT A B C

ALT AD : 779, DTHR : 769 (28 hPa)

CHAMBERY AIX LES BAINS



RNP Z RWY 18

ATIS CHAMBERY 127.100
APP : CHAMBERY Approche/Approach 121.205
TWR : CHAMBERY Tour/Tower 118.300

RNP APCH

EGNOS
Ch 63789
E18A
TCH : 46

VAR
2° E
(2020)

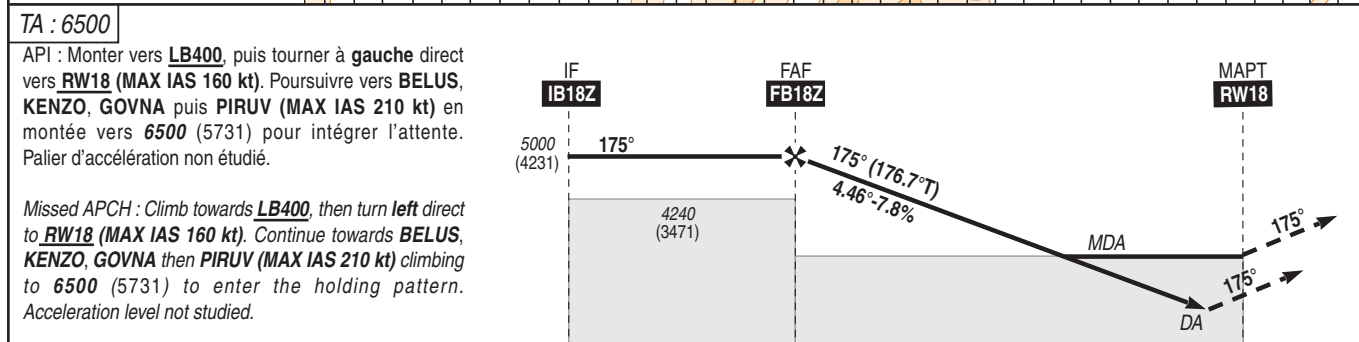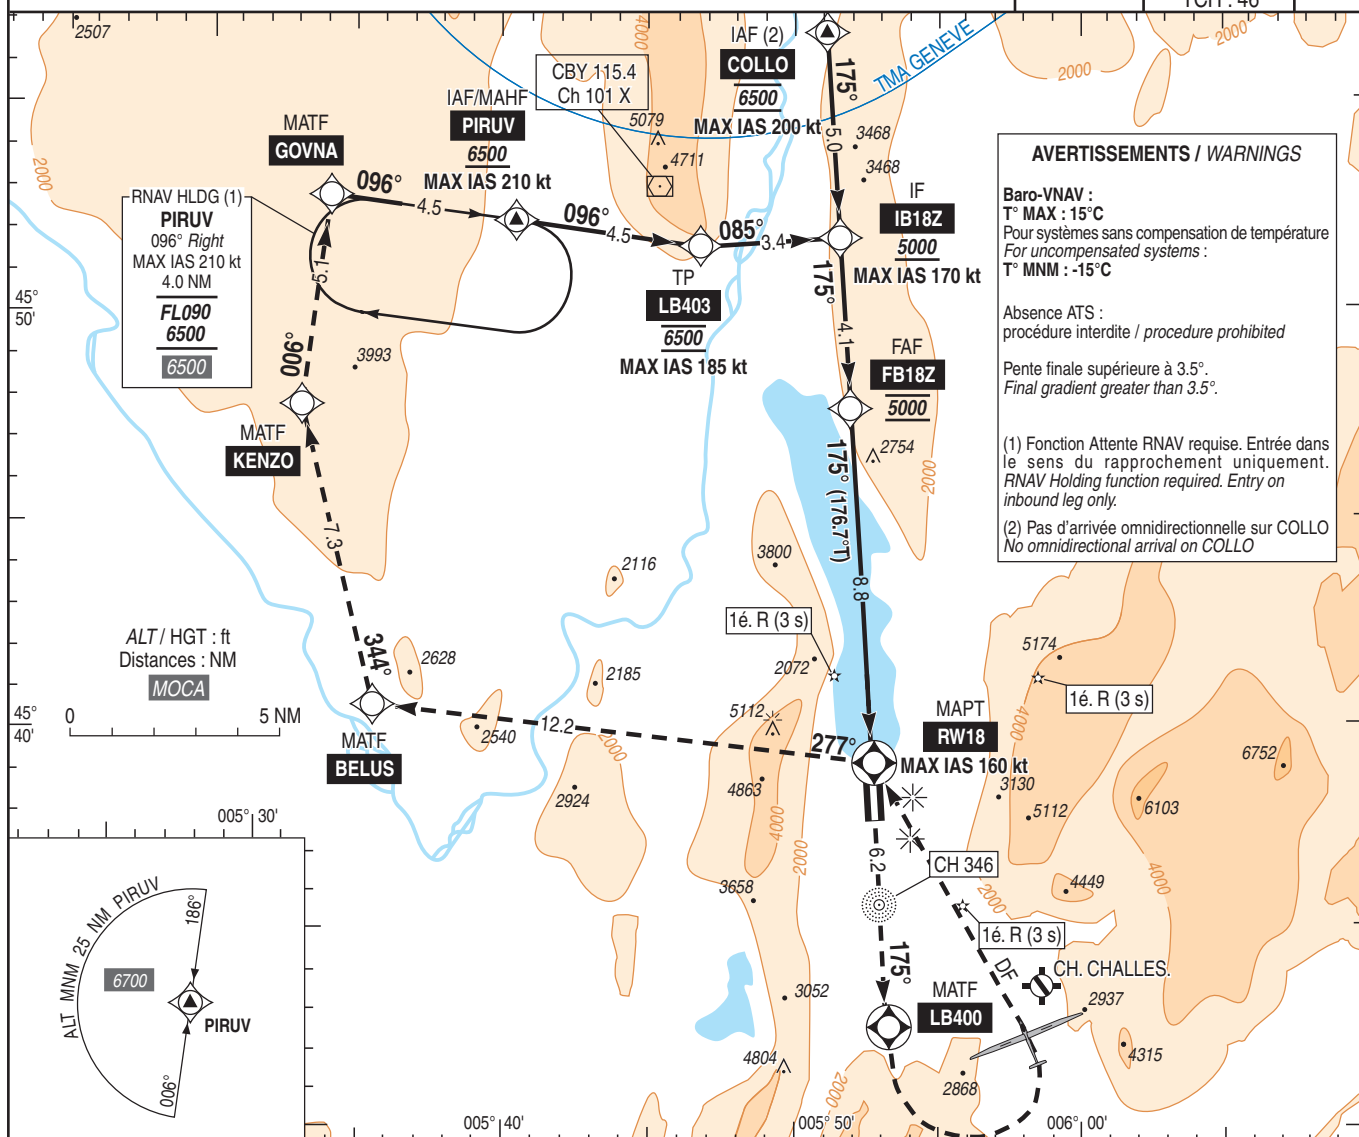

→ DTHR 13.0 8.8 0.0

MNM AD : voir / see AD 2 LFLB IAC RWY18 RNP Z MINIMA 01 et 02 REF HGT : ALT DTHR

DIST RW18	8	7	6	5
NM	8	7	6	5
ALT (HGT)	4605 (3836)	4135 (3366)	3660 (2891)	3185 (2416)

Observations / Remarks : Panne de guidage GNSS lors de l'approche / Loss of GNSS guidance during approach : voir / see AIP ENR 1.5
Activité planeurs fréquente et non nécessairement connue de l'ATC aux abords du segment LB400-RW18 / Frequent gliding activity not always known by ATC next to LB400-RW18 leg.

FAF - DTHR	8.8 NM	70 kt	85 kt	100 kt	115 kt	130 kt	145 kt	160 kt
VSP (ft/min)	555	7 min 33	6 min 13	5 min 17	4 min 35	4 min 04	3 min 38	3 min 18