



INSTRUMENT APPROACH CHART

RJKN / TOKUNOSHIMA

RNP Z RWY01

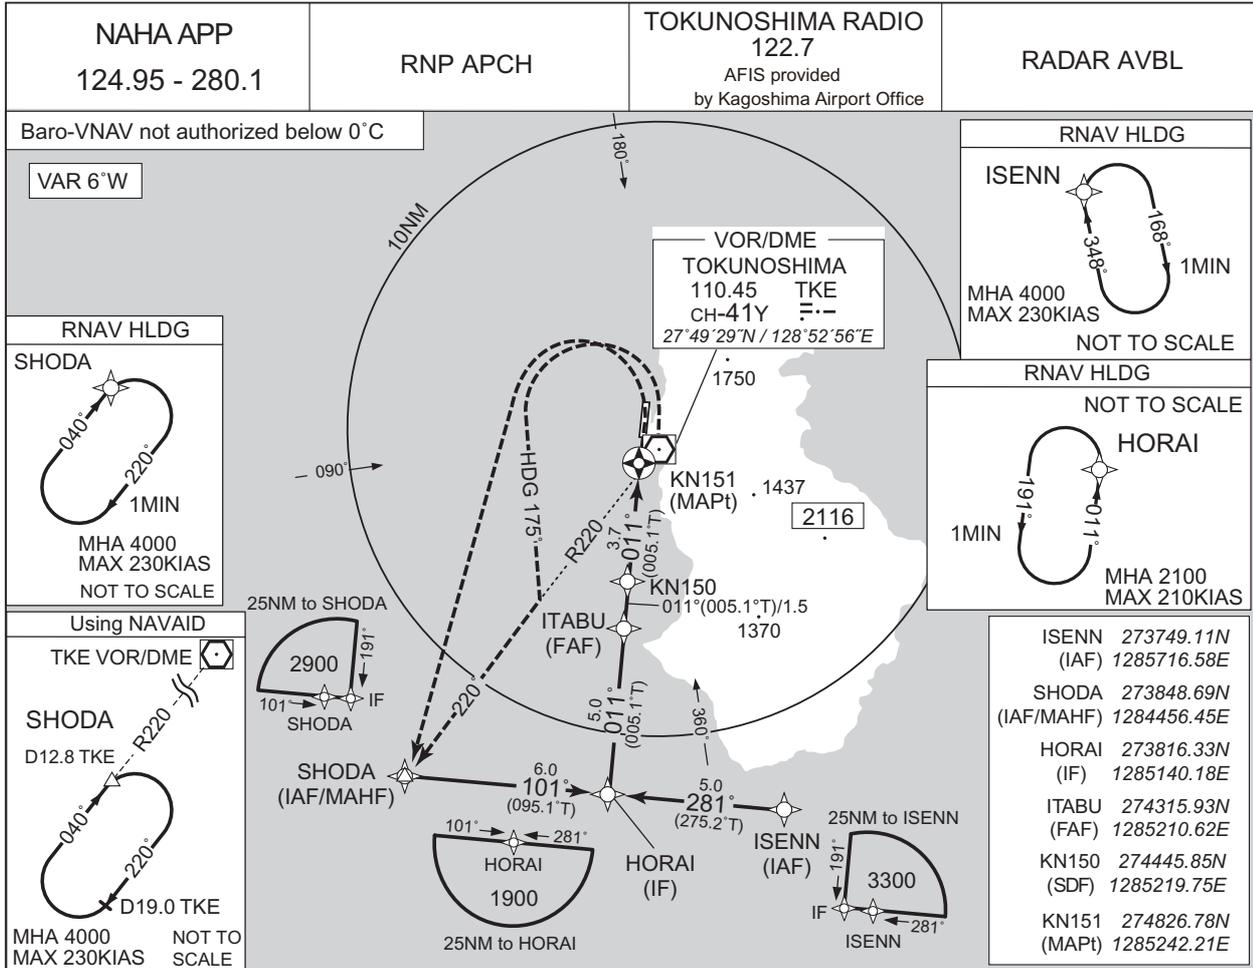

| | | | | | | | |
|----------------------|------|------|------|------|------|-----|------|
| NM to Next Fix | FAF | 5 | 4 | 3 | 2 | 1 | MAPt |
| ALT (3.0° APCH Path) | 2100 | 2040 | 1722 | 1403 | 1085 | 766 | - |

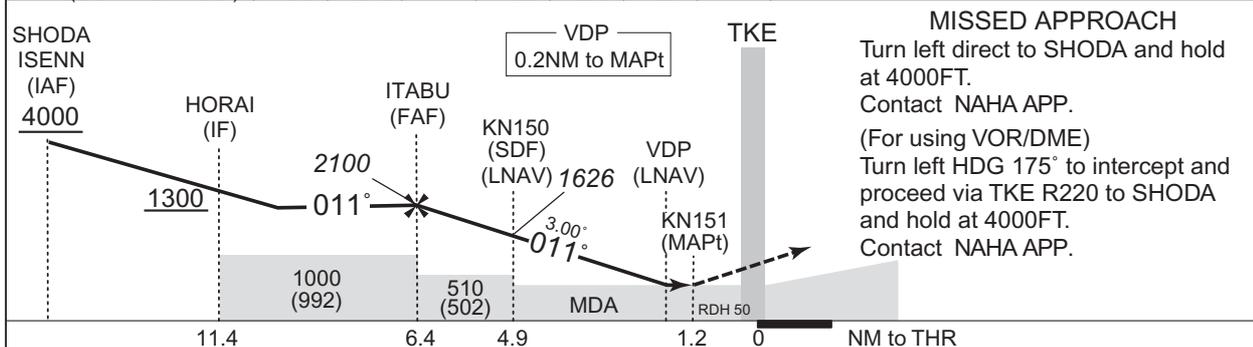

Missed APCH climb gradient MNM 5.0%

| CAT | THR elev. 17 | | AD elev. 8 | | VIS | |
|-----|--------------|------|------------|----------|-------------|------|
| | LNAV/VNAV | LNAV | LNAV | CIRCLING | | |
| | DA(H) | CMV | MDA(H) | CMV | MDA(H) | |
| A | 490 (473) | 1500 | 490 (482) | 1500 | 730 (722) | |
| B | | | | 1500 | 990 (982) | |
| C | | 2000 | | 2000 | 1190 (1182) | 2400 |
| D | | | | | 1480 (1472) | 3200 |

MINIMA with Missed APCH climb gradient of 2.5% are not established.
Circling to WEST side of RWY only.

CHANGE : Correction of misdescription(Missed APCH PROC).